

Signage - Dog Ban



Innate risk level

Actual risk level

Risk level: ■ Very low

✔ Risk score as low as possible

Remedial tasks: ■ 1

Maintenance Finding

Description

Additional comments are noted below.

Tasks

Read the notes for further action.

Note

Ownership details are recommended.

Photo not possible

Risk level:

■ Very low

Risk score:

■ 2

The Overall Site



Maintenance Finding

Description

Additional comments are noted below.

Tasks

Read the notes for further action.

Note

Covers on timbers to protect against strimmer damage have been known to retain moisture, accelerate timber decay and prevent inspection.

Risk level:

Low

Risk score:

7

Finding Photos



Balance Trail - Log


Manufactured by (Unknown)



Risk level:
Medium

Potential risk score reduction:
3

Remedial tasks:
3

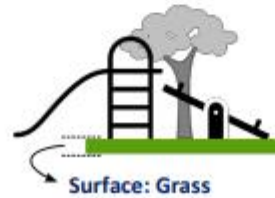

Standards:

EN 1176-1:2017

The item and its surfacing (where applicable) meet with the requirements of the relevant standards.

Maintenance Finding

Description

Fixtures loose or missing.

Tasks

Tighten.

Note

Top rail loose at upright.

Risk level:
Medium

Risk score:
8

Finding Photos



Maintenance Finding

Description

Timber is rotting.

Tasks

Replace rotten timbers.

Note

Stepping log.

Risk level:

 Medium

Risk score:

 8

Finding Photos



Maintenance Finding

Description

Strimmer damage to supports is likely to accelerate timber rot.

Tasks

Prevent further damage.

Risk level:

 Low

Risk score:

 6

Finding Photos



Basketball Post

Manufactured by Kompan Ltd



Standards:



EN 1270:2005, EN 15312:2007+A1:2010

The item and its surfacing (where applicable) meet with the requirements of the relevant standards.

Carousel - Supernova

Manufactured by Kompan Ltd



Standards:





EN 1176-1:2017, EN 1176-5:2019

The item and its surfacing (where applicable) meet with the requirements of the relevant standards.

Climber - Overhead - Ladder

Manufactured by (Unknown)

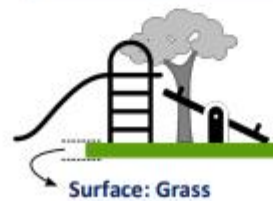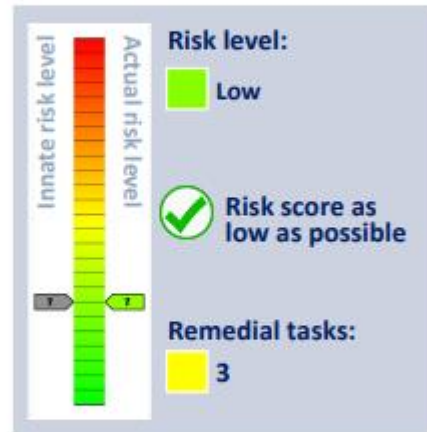

Standards:

EN 1176-1:2017

The item and its surfacing (where applicable) meet with the requirements of the relevant standards.

Maintenance Finding

Description

Suitably well maintained grass and topsoil with at least 150 mm of soil beneath is acceptable to EN 1176 for items with a fall height of up to 1.5 metres, subject to a risk assessment.

Tasks

Monitor to maintain the grass in good condition.

Risk level:

Low

Risk score:

7

Finding Photos



Maintenance Finding

Description

RoSPA is concerned by accidents on some types of overhead ladders and rings. However, there is a strong development value in these items.

Tasks

The protective surface under all bars and rings must be kept in good condition.

Risk level:

 Low

Risk score:

 7

Finding Photos



Maintenance Finding

Description

Strimmer damage to supports is likely to accelerate timber rot.

Tasks

Prevent further damage.

Risk level:

 Low

Risk score:

 6

Finding Photos



Climber - Rota Web

Manufactured by Tayplay Ltd



Standards:



EN 1176-1:2017, EN 1176-5:2019

The item and its surfacing (where applicable) meet with the requirements of the relevant standards.

Fitness - Walker

Manufactured by Kompan Ltd



Standards:



EN 16630:2015

The item and its surfacing (where applicable) meet with the requirements of the relevant standards.